

TECHNICAL INSTRUCTIONS PUBLICATION
AM PULSER
Pendant

For the Following Specs:

- 204297-1
- 204297A-1



OWNER'S MANUAL Number **430429-179**
Revised December 1, 1997

IMPORTANT: Read these instructions before installing, operating, or servicing this system.

THERMAL ARC INC., TROY, OHIO 45373-1085, U.S.A.

ARC WELDING SAFETY INSTRUCTIONS AND WARNINGS



WARNING

ARC WELDING can be hazardous.


PROTECT YOURSELF AND OTHERS FROM POSSIBLE SERIOUS INJURY OR DEATH. KEEP CHILDREN AWAY. PACEMAKER WEARERS KEEP AWAY UNTIL CONSULTING YOUR DOCTOR. DO NOT LOSE THESE INSTRUCTIONS. READ OPERATING/INSTRUCTION MANUAL BEFORE INSTALLING, OPERATING OR SERVICING THIS EQUIPMENT.

Welding products and welding processes can cause serious injury or death, or damage to other equipment or property, if the operator does not strictly observe all safety rules and take precautionary actions.

Safe practices have developed from past experience in the use of welding and cutting. These practices must be learned through study and training before using this equipment. Anyone not having extensive training in welding and cutting practices should not attempt to weld. Certain of the practices apply to equipment connected to power lines; other practices apply to engine driven equipment.

Safe practices are outlined in the American National Standard Z49.1 entitled: **SAFETY IN WELDING AND CUTTING**. This publication and other guides to what you should learn before operating this equipment are listed at the end of these safety precautions.

HAVE ALL INSTALLATION, OPERATION, MAINTENANCE, AND REPAIR WORK PERFORMED ONLY BY QUALIFIED PEOPLE.

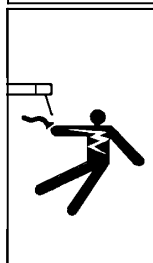


ELECTRIC SHOCK can kill.

Touching live electrical parts can cause fatal shocks or severe burns. The electrode and work circuit is electrically live whenever the output is on. The input power circuit and machine internal circuits are also live when power is on. In semiautomatic or automatic wire welding, the wire, wire reel, drive roll housing, and all metal parts touching the welding wire are electrically live. Incorrectly installed or improperly grounded equipment is a hazard.

1. Do not touch live electrical parts.
2. Wear dry, hole-free insulating gloves and body protection.
3. Insulate yourself from work and ground using dry insulating mats or covers.
4. Disconnect input power or stop engine before installing or servicing this equipment. Lock input power disconnect switch open, or remove line fuses so power cannot be turned on accidentally.
5. Properly install and ground this equipment according to its Owner's Manual and national, state, and local codes.

6. Turn off all equipment when not in use. Disconnect power to equipment if it will be left unattended or out of service.
7. Use fully insulated electrode holders. Never dip holder in water to cool it or lay it down on the ground or the work surface. Do not touch holders connected to two welding machines at the same time or touch other people with the holder or electrode.
8. Do not use worn, damaged, undersized, or poorly spliced cables.
9. Do not wrap cables around your body.
10. Ground the workpiece to a good electrical (earth) ground.
11. Do not touch electrode while in contact with the work (ground) circuit.
12. Use only well-maintained equipment. Repair or replace damaged parts at once.
13. In confined spaces or damp locations, do not use a welder with AC output unless it is equipped with a voltage reducer. Use equipment with DC output.
14. Wear a safety harness to prevent falling if working above floor level.
15. Keep all panels and covers securely in place.

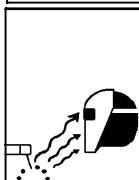

ARC RAYS can burn eyes and skin; NOISE can damage hearing.

Arc rays from the welding process produce intense heat and strong ultraviolet rays that can burn eyes and skin. Noise from some processes can damage hearing.

1. Wear a welding helmet fitted with a proper shade of filter (see ANSI Z49.1 listed in Safety Standards) to protect your face and eyes when welding or watching.
2. Wear approved safety glasses. Side shields recommended.
3. Use protective screens or barriers to protect others from flash and glare; warn others not to watch the arc.
4. Wear protective clothing made from durable, flame-resistant material (wool and leather) and foot protection.
5. Use approved ear plugs or ear muffs if noise level is high.

Eye protection filter shade selector for welding or cutting (goggles or helmet), from AWS A6.2-73.

Welding or Cutting Operation	Electrode Size Metal Thickness or Welding Current	Filter Shade No.	Welding or Cutting Operation	Electrode Size Metal Thickness or Welding Current	Filter Shade No.
Torch soldering	—	2	Gas metal-arc welding (MIG)		
Torch brazing	—	3 or 4	Non-ferrous base metal	All	11
Oxygen cutting			Ferrous base metal	All	12
Light	Under 1 in., 25 mm	3 or 4	Gas tungsten arc welding (TIG)	All	12
Medium	1 to 6 in., 25-150 mm	4 or 5	Atomic hydrogen welding	All	12
Heavy	Over 6 in., 150 mm	5 or 6	Carbon arc welding	All	12
Gas welding			Plasma arc welding	All	12
Light	Under 1/8 in., 3 mm	4 or 5	Carbon arc air gouging		
Medium	1/8 to 1/2 in., 3-12 mm	5 or 6	Light		12
Heavy	Over 1/2 in., 12 mm	6 or 8	Heavy		14
Shielded metal-arc welding (stick) electrodes	Under 5/32 in., 4 mm	10	Plasma arc cutting		
	5/32 to 1/4 in., 4 to 6.4 mm	12	Light	Under 300 Amp	9
	Over 1/4 in., 6.4 mm	14	Medium	300 to 400 Amp	12
			Heavy	Over 400 Amp	14

ARC WELDING SAFETY INSTRUCTIONS AND WARNINGS

Instruction 830001



FUMES AND GASES can be hazardous to your health.

Welding produces fumes and gases. Breathing these fumes and gases can be hazardous to your health.

1. Keep your head out of the fumes. Do not breathe the fumes.
2. If inside, ventilate the area and/or use exhaust at the arc to remove welding fumes and gases.
3. If ventilation is poor, use an approved air-supplied respirator.

4. Read the Material Safety Data Sheets (MSDSs) and the manufacturer's instruction for metals, consumables, coatings, and cleaners.
5. Work in a confined space only if it is well ventilated, or while wearing an air-supplied respirator. Shielding gases used for welding can displace air causing injury or death. Be sure the breathing air is safe.
6. Do not weld in locations near degreasing, cleaning, or spraying operations. The heat and rays of the arc can react with vapors to form highly toxic and irritating gases.
7. Do not weld on coated metals, such as galvanized, lead, or cadmium plated steel, unless the coating is removed from the weld area, the area is well ventilated, and if necessary, while wearing an air-supplied respirator. The coatings and any metals containing these elements can give off toxic fumes if welded.




WELDING can cause fire or explosion.

Sparks and spatter fly off from the welding arc. The flying sparks and hot metal, weld spatter, hot workpiece, and hot equipment can cause fires and burns. Accidental contact of electrode or welding wire to metal objects can cause sparks, overheating, or fire.

1. Protect yourself and others from flying sparks and hot metal.
2. Do not weld where flying sparks can strike flammable material.
3. Remove all flammables within 35 ft (10.7 m) of the welding arc. If this is not possible, tightly cover them with approved covers.
4. Be alert that welding sparks and hot materials from welding can easily go through small cracks and openings to adjacent areas.


5. Watch for fire, and keep a fire extinguisher nearby.
6. Be aware that welding on a ceiling, floor, bulkhead, or partition can cause fire on the hidden side.
7. Do not weld on closed containers such as tanks or drums.
8. Connect work cable to the work as close to the welding area as practical to prevent welding current from traveling long, possibly unknown paths and causing electric shock and fire hazards.
9. Do not use welder to thaw frozen pipes.
10. Remove stick electrode from holder or cut off welding wire at contact tip when not in use.
11. Wear oil-free protective garments such as leather gloves, heavy shirt, cuffless trousers, high shoes, and a cap.

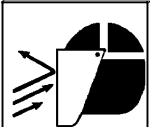

FLYING SPARKS AND HOT METAL can cause injury.

Chipping and grinding cause flying metal. As welds cool, they can throw off slag.

1. Wear approved face shield or safety goggles. Side shields recommended.
2. Wear proper body protection to protect skin.

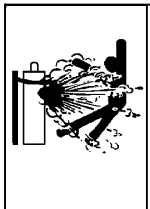

CYLINDERS can explode if damaged.

Shielding gas cylinders contain gas under high pressure. If damaged, a cylinder can explode. Since gas cylinders are normally part of the welding process, be sure to treat them carefully.

1. Protect compressed gas cylinders from excessive heat, mechanical shocks, and arcs.
2. Install and secure cylinders in an upright position by chaining them to a stationary support or equipment cylinder rack to prevent falling or tipping.

3. Keep cylinders away from any welding or other electrical circuits.
4. Never allow a welding electrode to touch any cylinder.
5. Use only correct shielding gas cylinders, regulators, hoses, and fittings designed for the specific application; maintain them and associated parts in good condition.
6. Turn face away from valve outlet when opening cylinder valve.
7. Keep protective cap in place over valve except when cylinder is in use or connected for use.
8. Read and follow instructions on compressed gas cylinders, associated equipment, and CGA publication P-1 listed in Safety Standards.



WARNING

ENGINES can be hazardous.







ENGINE EXHAUST GASES can kill.

Engines produce harmful exhaust gases.

1. Use equipment outside in open, well-ventilated areas.
2. If used in a closed area, vent engine exhaust outside and away from any building air intakes.

ARC WELDING SAFETY INSTRUCTIONS AND WARNINGS
Instruction 830001

	ENGINE FUEL can cause fire or explosion. Engine fuel is highly flammable. 1. Stop engine before checking or adding fuel.	2. Do not add fuel while smoking or if unit is near any sparks or open flames. 3. Allow engine to cool before fueling. If possible, check and add fuel to cold engine before beginning job. 4. Do not overfill tank — allow room for fuel to expand. 5. Do not spill fuel. If fuel is spilled, clean up before starting engine.
	MOVING PARTS can cause injury. Moving parts, such as fans, rotors, and belts can cut fingers and hands and catch loose clothing. 1. Keep all doors, panels, covers, and guards closed and securely in place. 2. Stop engine before installing or connecting unit.	3. Have only qualified people remove guards or covers for maintenance and troubleshooting as necessary. 4. To prevent accidental starting during servicing, disconnect negative (-) battery cable from battery. 5. Keep hands, hair, loose clothing, and tools away from moving parts. 6. Reinstall panels or guards and close doors when servicing is finished and before starting engine.
	SPARKS can cause BATTERY GASES TO EXPLODE; BATTERY ACID can burn eyes and skin. Batteries contain acid and generate explosive gases.	1. Always wear a face shield when working on a battery. 2. Stop engine before disconnecting or connecting battery cables. 3. Do not allow tools to cause sparks when working on a battery. 4. Do not use welder to charge batteries or jump start vehicles. 5. Observe correct polarity (+ and -) on batteries.
	STEAM AND PRESSURIZED HOT COOLANT can burn face, eyes, and skin. The coolant in the radiator can be very hot and under pressure.	1. Do not remove radiator cap when engine is hot. Allow engine to cool. 2. Wear gloves and put a rag over cap area when removing cap. 3. Allow pressure to escape before completely removing cap.

WARNING: This product, when used for welding or cutting, produces fumes or gases which contain chemicals known to the State of California to cause birth defects and, in some cases, cancer. (California Health & Safety Code Sec. 25249.5 et seq.)

NOTE: Considerations About Welding And The Effects Of Low Frequency Electric And Magnetic Fields

The following is a quotation from the General Conclusions Section of the U.S. Congress, Office of Technology Assessment, Biological Effects of Power Frequency Electric & Magnetic Fields — Background Paper, OTA-BP-E-63 (Washington, DC: U.S. Government Printing Office, May 1989): "... there is now a very large volume of scientific findings based on experiments at the cellular level and from studies with animals and people which clearly establish that low frequency magnetic fields can interact with, and produce changes in, biological systems. While most of this work is of very high quality, the results are complex. Current scientific understanding does not yet allow us to interpret the evidence in a single coherent framework. Even more frustrating, it does not yet allow us to draw definite conclusions about questions of possible risk or to offer clear science-based advice on strategies to minimize or avoid potential risks."

To reduce magnetic fields in the workplace, use the following procedures:

1. Keep cables close together by twisting or taping them.
2. Arrange cables to one side and away from the operator.
3. Do not coil or drape cables around the body.
4. Keep welding power source and cables as far away from body as practical.

About Pacemakers:

The above procedures are among those also normally recommended for pacemaker wearers. Consult your doctor for complete information.

PRINCIPAL SAFETY STANDARDS

Safety in Welding and Cutting, ANSI Standard Z49.1, from American Welding Society, 550 N.W. LeJeune Rd., Miami, FL 33126.

Safety and Health Standards, OSHA 29 CFR 1910, from Superintendent of Documents, U.S. Government Printing Office, Washington, D.C. 20402.

Recommended Safe Practices for the Preparation for Welding and Cutting of Containers That Have Held Hazardous Substances, American Welding Society Standard AWS F4.1, from American Welding Society, 550 N.W. LeJeune Rd., Miami, FL 33126.

National Electrical Code, NFPA Standard 70, from National Fire Protection Association, Batterymarch Park, Quincy, MA 02269.

Safe Handling of Compressed Gases in Cylinders, CGA Pamphlet P-1, from Compressed Gas Association, 1235 Jefferson Davis Highway, Suite 501, Arlington, VA 22202.

Code for Safety in Welding and Cutting, CSA Standard W117.2, from Canadian Standards Association, Standards Sales, 178 Rexdale Boulevard, Rexdale, Ontario, Canada M9W 1R3.

Safe Practices for Occupation and Educational Eye and Face Protection, ANSI Standard Z87.1, from American National Standards Institute, 1430 Broadway, New York, NY 10018.

Cutting and Welding Processes, NFPA Standard 51B, from National Fire Protection Association, Batterymarch Park, Quincy, MA 02269.

This page intentionally left blank.

PRECAUTIONS DE SECURITE EN SOUDAGE A L'ARC

MISE EN GARDE

LE SOUDAGE A L'ARC EST DANGEREUX

PROTEGEZ-VOUS, AINSI QUE LES AUTRES, CONTRE LES BLESSURES GRAVES POSSIBLES OU LA MORT. NE LAISSEZ PAS LES ENFANTS S'APPROCHER, NI LES PORTEURS DE STIMULATEUR CARDIAQUE (A MOINS QU'ILS N'AIENT CONSULTE UN MEDECIN). CONSERVEZ CES INSTRUCTIONS. LISEZ LE MANUEL D'OPERATION OU LES INSTRUCTIONS AVANT D'INSTALLER, UTILISER OU ENTREtenir CET EQUIPEMENT.

Les produits et procédés de soudage peuvent sauser des blessures graves ou la mort, de même que des dommages au reste du matériel et à la propriété, si l'utilisateur n'adhère pas strictement à toutes les règles de sécurité et ne prend pas les précautions nécessaires.

En soudage et coupage, des pratiques sécuritaires se sont développées suite à l'expérience passée. Ces pratiques doivent être apprises par étude ou entraînement avant d'utiliser l'équipement. Toute personne n'ayant pas suivi un entraînement intensif en soudage et coupage ne devrait pas tenter de souder. Certaines pratiques concernent les équipements raccordés aux lignes d'alimentation alors que d'autres s'adressent aux groupes électrogènes.

La norme Z49.1 de l'American National Standard, intitulée "SAFETY IN WELDING AND CUTTING" présente les pratiques sécuritaires à suivre. Ce document ainsi que d'autres guides que vous devriez connaître avant d'utiliser cet équipement sont présentés à la fin de ces instructions de sécurité.

SEULES DES PERSONNES QUALIFIEES DOIVENT FAIRE DES TRAVAUX D'INSTALLATION, DE REPARATION, D'ENTRETIEN ET D'ESSAI.



L'ELECTROCUTION PEUT ETRE MORTELLE.

Une décharge électrique peut tuer ou brûler gravement. L'électrode et le circuit de soudage sont sous tension dès la mise en circuit. Le circuit d'alimentation et les circuits internes de l'équipement sont aussi sous tension dès la mise en marche. En soudage automatique ou semi-automatique avec fil, ce dernier, le rouleau ou la bobine de fil, le logement des galets d'entraînement et toutes les pièces métalliques en contact avec le fil de soudage sont sous tension. Un équipement inadéquatement installé ou inadéquatement mis à la terre est dangereux.

1. Ne touchez pas à des pièces sous tension.
2. Portez des gants et des vêtements isolants, secs et non troués.
3. Isolez-vous de la pièce à souder et de la mise à la terre au moyen de tapis isolants ou autres.
4. Déconnectez la prise d'alimentation de l'équipement ou arrêtez le moteur avant de l'installer ou d'en faire l'entretien. Bloquez le commutateur en circuit ouvert ou enlevez les fusibles de l'alimentation afin d'éviter une mise en marche accidentelle.
5. Veuillez à installer cet équipement et à le mettre à la terre selon le manuel d'utilisation et les codes nationaux, provinciaux et locaux applicables.

6. Arrêtez tout équipement après usage. Coupez l'alimentation de l'équipement s'il est hors d'usage ou inutilisé.
7. N'utilisez que des porte-électrodes bien isolés. Ne jamais plonger les porte-électrodes dans l'eau pour les refroidir. Ne jamais les laisser traîner par terre ou sur les pièces à souder. Ne touchez pas aux porte-électrodes raccordés à deux sources de courant en même temps. Ne jamais toucher quelqu'un d'autre avec l'électrode ou le porte-électrode.
8. N'utilisez pas de câbles électriques usés, endommagés, mal épissés ou de section trop petite.
9. N'enroulez pas de câbles électriques autour de votre corps.
10. N'utilisez qu'une bonne prise de masse pour la mise à la terre de la pièce à souder.
11. Ne touchez pas à l'électrode lorsqu'en contact avec le circuit de soudage (terre).
12. N'utilisez que des équipements en bon état. Réparez ou remplacez aussitôt les pièces endommagées.
13. Dans des espaces confinés ou mouillés, n'utilisez pas de source de courant alternatif, à moins qu'il soit muni d'un réducteur de tension. Utilisez plutôt une source de courant continu.
14. Portez un harnais de sécurité si vous travaillez en hauteur.
15. Fermez solidement tous les panneaux et les capots.



LE RAYONNEMENT DE L'ARC PEUT BRÛLER LES YEUX ET LA PEAU; LE BRUIT PEUT ENDOMMAGER L'OUÏE.

L'arc de soudage produit une chaleur et des rayons ultraviolets intenses, susceptibles de brûler les yeux et la peau. Le bruit causé par certains procédés peut endommager l'ouïe.

1. Portez une casque de soudeur avec filtre oculaire de nuance appropriée (consultez la norme ANSI Z49 indiquée ci-après)

pour vous protéger le visage et les yeux lorsque vous soudez ou que vous observez l'exécution d'une soudure.

2. Portez des lunettes de sécurité approuvées. Des écrans latéraux sont recommandés.
3. Entourez l'aire de soudage de rideaux ou de cloisons pour protéger les autres des coups d'arc ou de l'éblouissement; avertissez les observateurs de ne pas regarder l'arc.
4. Portez des vêtements en matériaux ignifuges et durables (laine et cuir) et des chaussures de sécurité.
5. Portez un casque antibruit ou des bouchons d'oreille approuvés lorsque le niveau de bruit est élevé.

PRECAUTIONS DE SECURITE EN SOUDAGE A L'ARC

Instruction 830002

SELECTION DES NUANCES DE FILTRES OCULAIRES POUR LA PROTECTION DES YEUX EN COUPAGE ET SOUDAGE (selon AWS A 8.2-73)

Opération de Coupage ou soudage	Dimension d'électrode ou Epaisseur de métal ou Intensité de courant	Nuance de de filtre oculaire
Brasage tendre au chalumeau	toutes conditions	2
Brasage fort au chalumeau	toutes conditions	3 ou 4
Oxycoupage		
mince	moins de 1 po. (25 mm)	2 ou 3
moyen	de 1 à 6 po. (25 à 150 mm)	4 ou 5
épais	plus de 6 po. (150 mm)	5 ou 6
Soudage aux gaz		
mince	moins de 1/8 po. (3 mm)	4 ou 5
moyen	de 1/8 à 1/2 po. (3 à 12 mm)	5 ou 6
épais	plus de 1/2 po. (12 mm)	6 ou 8
Soudage à l'arc avec electrode enrobées (SMAW)	moins de 5/32 po. (4 mm)	10
	de 5/32 à 1/4 po. (4 à 6.4 mm)	12
	plus de 1/4 po. (6.4 mm)	14
Soudage à l'arc sous gaz avec fil plein (GMAW)		
métaux non-ferreux	toutes conditions	11
métaux ferreux	toutes conditions	12
Soudage à l'arc sous gaz avec électrode de tungstène (GTAW)	toutes conditions	12
Soudage à l'hydrogène atomique (AHW)	toutes conditions	12
Soudage à l'arc avec électrode de carbone (CAW)	toutes conditions	12
Soudage à l'arc Plasma (PAW)	toutes dimensions	12
Gougeage Air-Arc avec électrode de carbone		
mince		12
épais		14
Coupage à l'arc Plasma (PAC)		
mince	moins de 300 ampères	9
moyen	de 300 à 400 ampères	12
épais	plus de 400 ampères	14



LES VAPEURS ET LES FUMÉES SONT DANGEREUSES POUR LA SANTÉ.

Le soudage dégage des vapeurs et des fumées dangereuses à respirer.

- Eloignez la tête des fumées pour éviter de les respirer.
- A l'intérieur, assurez-vous que l'aire de soudage est bien ventilée ou que les fumées et les vapeurs sont aspirées à l'arc.
- Si la ventilation est inadéquate, portez un respirateur à adduction d'air approuvé.
- Lisez les fiches signalétiques et les consignes du fabricant relatives aux métaux, aux produits consommables, aux revêtements et aux produits nettoyants.
- Ne travaillez dans un espace confiné que s'il est bien ventilé; sinon, portez un respirateur à adduction d'air. Les gaz protecteurs de soudage peuvent déplacer l'oxygène de l'air et ainsi causer des malaises ou la mort. Assurez-vous que l'air est propre à la respiration.
- Ne soudez pas à proximité d'opérations de dégraissage, de nettoyage ou de pulvérisation. La chaleur et les rayons de l'arc peuvent réagir avec des vapeurs et former des gaz hautement toxiques et irritants.
- Ne soudez des tôles galvanisées ou plaquées au plomb ou au cadmium que si les zones à souder ont été grattées à fond, que si l'espace est bien ventilé; si nécessaire portez un respirateur à adduction d'air. Car ces revêtements et tout métal qui contient ces éléments peuvent dégager des fumées toxiques au moment du soudage.



LE SOUDAGE PEUT CAUSER UN INCENDIE OU UNE EXPLOSION

L'arc produit des étincelles et des projections. Les particules volantes, le métal chaud, les projections de soudure et l'équipement surchauffé peuvent causer un incendie et des brûlures. Le contact accidentel de l'électrode ou du fil-électrode avec un

objet métallique peut provoquer des étincelles, un échauffement ou un incendie.

1. Protégez-vous, ainsi que les autres, contre les étincelles et du métal chaud.
2. Ne soudez pas dans un endroit où des particules volantes ou des projections peuvent atteindre des matériaux inflammables.
3. Enlevez toutes matières inflammables dans un rayon de 10, 7 mètres autour de l'arc, ou couvrez-les soigneusement avec des bâches approuvées.

4. Méfiez-vous des projections brûlantes de soudage susceptibles de pénétrer dans des aires adjacentes par de petites ouvertures ou fissures.
5. Méfiez-vous des incendies et gardez un extincteur à portée de la main.
6. N'oubliez pas qu'une soudure réalisée sur un plafond, un plancher, une cloison ou une paroi peut enflammer l'autre côté.
7. Ne soudez pas un récipient fermé, tel un réservoir ou un baril.
8. Connectez le câble de soudage le plus près possible de la zone de soudage pour empêcher le courant de suivre un long parcours inconnu, et prévenir ainsi les risques d'électrocution et d'incendie.
9. Ne dégagez pas les tuyaux avec un source de courant.
10. Otez l'électrode du porte-électrode ou coupez le fil au tube-contact lorsqu'inutilisé après le soudage.
11. Portez des vêtements protecteurs non huileux, tels des gants en cuir, une chemise épaisse, un pantalon revers, des bottines de sécurité et un casque.



LES ETINCELLES ET LES PROJECTIONS BRULANTES PEUVENT CAUSER DES BLESSURES.

Le piquage et le meulage produisent des particules métalliques volantes. En refroidissant, la soudure peut projeter du éclats de laitier.

1. Portez un écran facial ou des lunettes protectrices approuvées. Des écrans latéraux sont recommandés.
2. Portez des vêtements appropriés pour protéger la peau.



LES BOUTEILLES ENDOMMAGEES PEUVENT EXPLOSER

Les bouteilles contiennent des gaz protecteurs sous haute pression. Des bouteilles endommagées peuvent exploser. Comme les bouteilles font normalement partie du procédé de soudage, traitez-les avec soin.

1. Protégez les bouteilles de gaz comprimé contre les sources de chaleur intense, les chocs et les arcs de soudage.
2. Enchaînez verticalement les bouteilles à un support ou à un cadre fixe pour les empêcher de tomber ou d'être renversées.
3. Eloignez les bouteilles de tout circuit électrique ou de tout soudage.

4. Empêchez tout contact entre une bouteille et une électrode de soudage.
5. N'utilisez que des bouteilles de gaz protecteur, des détendeurs, des boyaux et des raccords conçus pour chaque application spécifique; ces équipements et les pièces connexes doivent être maintenus en bon état.
6. Ne placez pas le visage face à l'ouverture du robinet de la bouteille lors de son ouverture.
7. Laissez en place le chapeau de bouteille sauf si en utilisation ou lorsque raccordé pour utilisation.
8. Lisez et respectez les consignes relatives aux bouteilles de gaz comprimé et aux équipements connexes, ainsi que la publication P-1 de la CGA, identifiée dans la liste de documents ci-dessous.

MISE EN GARDE



LES GAZ D'ÉCHAPPEMENT DES MOTEURS PEUVENT ÊTRE MORTELS.

Les moteurs produisent des gaz d'échappement nocifs.

LES MOTEURS PEUVENT ÊTRE DANGEREUX

1. Utilisez l'équipement à l'extérieur dans des aires ouvertes et bien ventilées.
2. Si vous utilisez ces équipements dans un endroit confiné, les fumées d'échappement doivent être envoyées à l'extérieur, loin des prises d'air du bâtiment.



LE CARBURANT PEUT CAUSER UN INCENDIE OU UNE EXPLOSION.

Le carburant est hautement inflammable.

1. Arrêtez le moteur avant de vérifier le niveau de carburant ou de faire le plein.

2. Ne faites pas le plein en fumant ou proche d'une source d'étincelles ou d'une flamme nue.
3. Si c'est possible, laissez le moteur refroidir avant de faire le plein de carburant ou d'en vérifier le niveau au début du soudage.
4. Ne faites pas le plein de carburant à ras bord: prévoyez de l'espace pour son expansion.
5. Faites attention de ne pas renverser de carburant. Nettoyez tout carburant renversé avant de faire démarrer le moteur.

PRECAUTIONS DE SECURITE EN SOUDAGE A L'ARC

Instruction 830002




DES PIÈCES EN MOUVEMENT PEUVENT CAUSER DES BLESSURES.

Des pièces en mouvement, tels des ventilateurs, des rotors et des courroies peuvent couper doigts et mains, ou accrocher des vêtements amples.

1. Assurez-vous que les portes, les panneaux, les capots et les protecteurs soient bien fermés.
2. Avant d'installer ou de connecter un système, arrêtez le moteur.

3. Seules des personnes qualifiées doivent démonter des protecteurs ou des capots pour faire l'entretien ou le dépannage nécessaire.
4. Pour empêcher un démarrage accidentel pendant l'entretien, débranchez le câble d'accumulateur à la borne négative.
5. N'approchez pas les mains ou les cheveux de pièces en mouvement; elles peuvent aussi accrocher des vêtements amples et des outils.
6. Réinstallez les capots ou les protecteurs et fermez les portes après des travaux d'entretien et avant de faire démarrer le moteur.

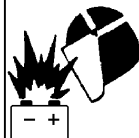

DES ETINCELLES PEUVENT FAIRE EXPLOSER UN ACCUMULATEUR; L'ELECTROLYTE D'UN ACCUMULATEUR PEUT BRULER LA PEAU ET LES YEUX.

Les accumulateurs contiennent de l'électrolyte acide et dégagent des vapeurs explosives.

1. Portez toujours un écran facial en travaillant sur un accumulateur.
2. Arrêtez le moteur avant de connecter ou de déconnecter des câbles d'accumulateur.
3. N'utilisez que des outils anti-étincelles pour travailler sur un accumulateur.
4. N'utilisez pas une source de courant de soudage pour charger un accumulateur ou survolter momentanément un véhicule.
5. Utilisez la polarité correcte (+ et -) de l'accumulateur.



LA VAPEUR ET LE LIQUIDE DE REFROIDISSEMENT BRULANT SOUS PRESSION PEUVENT BRULER LA PEAU ET LES YEUX.

Le liquide de refroidissement d'un radiateur peut être brûlant et sous pression.

1. N'ôtez pas le bouchon de radiateur tant que le moteur n'est pas refroidi.
2. Mettez des gants et posez un torchon sur le bouchon pour l'ôter.
3. Laissez la pression s'échapper avant d'ôter complètement le bouchon.

PRINCIPALES NORMES DE SECURITE

Safety in Welding and Cutting, norme ANSI Z49.1, American Welding Society, 550 N.W. LeJeune Rd., Miami, FL 33128.

Safety and Health Standards, OSHA 29 CFR 1910, Superintendent of Documents, U.S. Government Printing Office, Washington, D.C. 20402.

Recommended Safe Practices for the Preparation for Welding and Cutting of Containers That Have Held Hazardous Substances, norme AWS F4.1, American Welding Society, 550 N.W. LeJeune Rd., Miami, FL 33128.

National Electrical Code, norme 70 NFPA, National Fire Protection Association, Batterymarch Park, Quincy, MA 02269.

Safe Handling of Compressed Gases in Cylinders, document P-1, Compressed Gas Association, 1235 Jefferson Davis Highway, Suite 501, Arlington, VA 22202.

Code for Safety in Welding and Cutting, norme CSA W117.2 Association canadienne de normalisation, Standards Sales, 276 Rexdale Boulevard, Rexdale, Ontario, Canada M9W 1R3.

Safe Practices for Occupation and Educational Eye and Face Protection, norme ANSI Z87.1, American National Standards Institute, 1430 Broadway, New York, NY 10018.

Cutting and Welding Processes, norme 51B NFPA, National Fire Protection Association, Batterymarch Park, Quincy, MA 02269.

AM PULSER PENDANT 204297-1 & 204297A-1

DESCRIPTION, CONTROLS AND PARTS LIST

Description

The AM Pulser has been designed to provide pulsation control to the ARC-MASTER, ULTRA FLEX, and EXCEL-ARC line of products. The AM Pulser provides high and low pulse modes for the weld current. Controls for the regulation of the time duration and percentage of maximum weld current are provided. The AM Pulser attaches to the power sources with a control cable that mates with the nineteen-pin amphenol on the power source.

The AM Pulser should be used with the following output and contactor control options:

Foot Control — 200460-7.

Remote Control Pendant — 492330-9.

SEE TYPICAL INSTALLATION FIGURE FOR DETAILS ON HOW THE ARC-MASTER AND EXCEL-ARC SHOULD BE SET UP.

Controls

1. Function Selector

Pulse ON	The pulser is activated.
No pulse	The pulsing function has been disabled. The weld current control will set the percent of maximum current that will be output, i.e., If the weld current control on the pulser is set to 50%, the ARC-MASTER 500 will produce 50% of its maximum output, 250 amps.

The current being set can be seen on the power source meter.

Pendant OFF The AM Pulser has been disabled.

2. Pendant/Remote Switch — Local/Remote switch for weld current. In the pendant position, the weld current control is adjustable on the pulser. The high pulse weld current can be seen on the power source front panel meter. In the remote position, the weld current control on the front of the AM Pulser sets the maximum amperage available and the remote control, plugged into the nineteen-pin amphenol on the rear of the AM Pulser, fine tunes the amperage level.

3. High Pulse Time Control — Adjusts the time duration for the high pulse.

4. Weld Current Control — Adjusts the high pulse welding output current. This control sets the percentage of machine maximum output.

5. Low Pulse Time Control — Adjusts the time duration for the low pulse.

6. % Weld Current Control — Adjusts the low pulse welding output current. This control sets the low pulse current as a percentage of the high pulse current.

7. Remote Control Receptacle — Provides connection point for the remote controls to the pendant (hand or foot control).

8. Slow/Med/Fast Control — Determines the range of times that the high pulse time and low pulse time controls can be set.



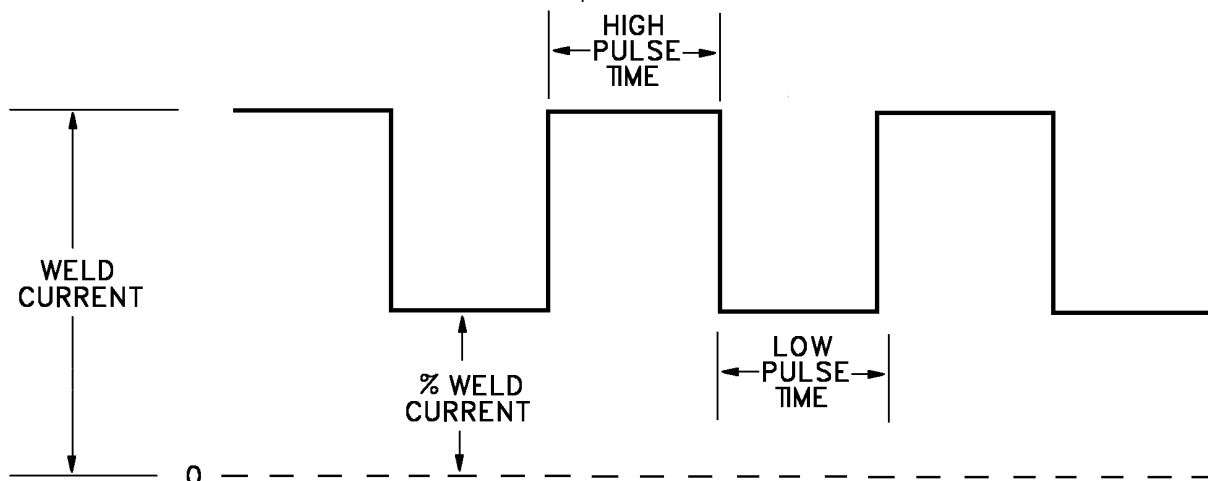


Figure 1

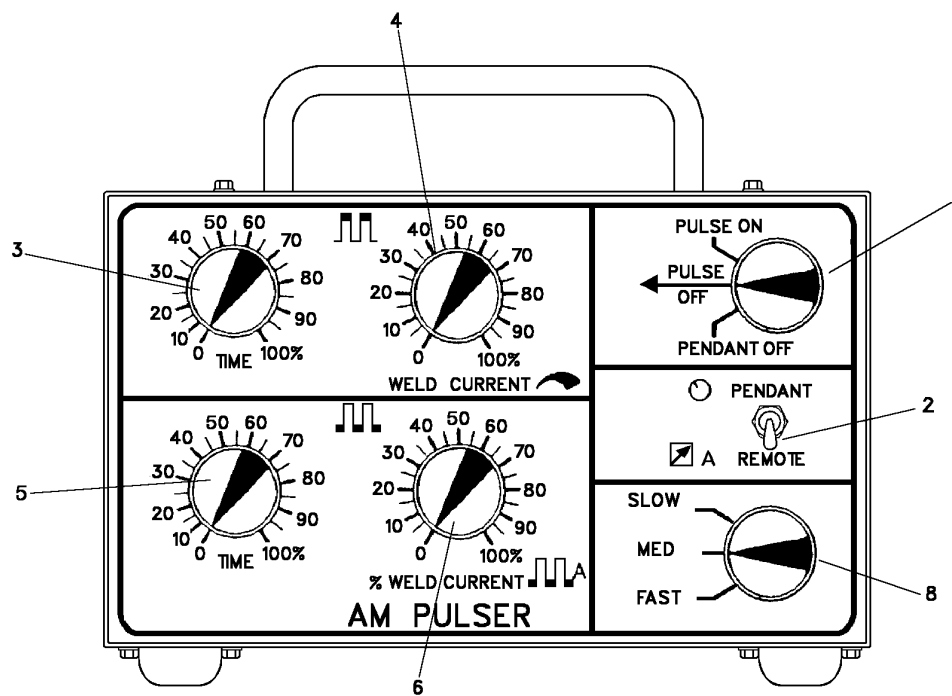

CONTROL PANEL

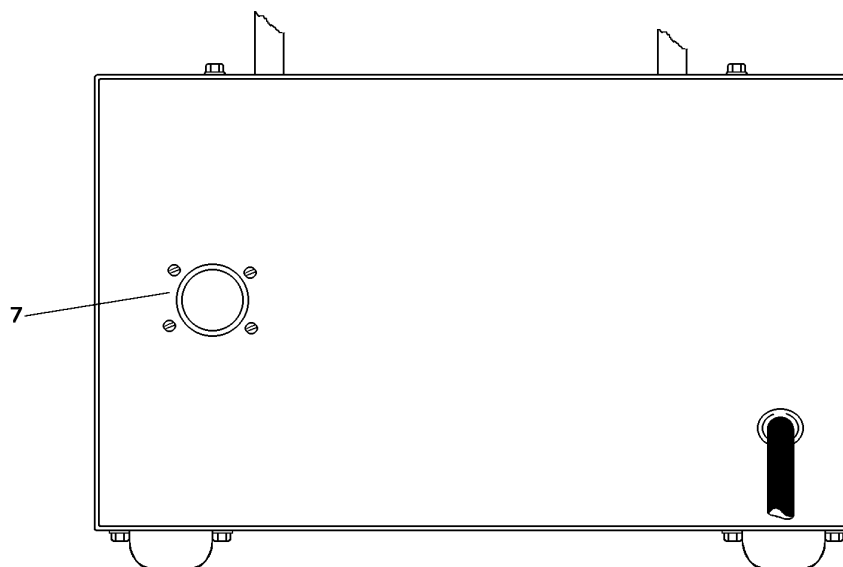

REAR PANEL

Figure 2

TRANSLATING PULSE TIME TO PULSES/SEC

Example:

- ① { High Pulse Time = 1ms = .001 sec
Low Pulse Time = 1ms = .001 sec
Total Pulse Time = 2ms = .002 sec
- ② Pulses/Second = $1/2\text{ms} = 1/.002 \text{ sec} = 500 \text{ Pulses/Second}$

Step ① add the High Pulse Time to Low Pulse Time.

Step ② 1 divided by total pulse time is the pulses/second.

Figure 3

POWER SOURCE	MAXIMUM OUTPUT WITH PULSER
ARC-MASTER 501	500 AMPS
ARC-MASTER 351	350 AMPS
EXCEL-ARC 4030 CC	320 AMPS
EXCEL-ARC 6045 CC or CC/CV	502 AMPS
EXCEL-ARC 8065 CC or CC/CV	640 AMPS
ULTRA FLEX 350 CC/CV	375 AMPS
ULTRA FLEX 350 PULSE	375 AMPS


Figure 4

Installation

The AM Pulser is sent from the factory configured for the Arc-Master and no configuration is necessary.

To configure the Pulser for the Excel-Arc and Ultra Flex line of products, a jumper on the front panel control board must be moved. Remove the four

screws on the top and bottom of the Pulser. The top panel should slide off. On the rear of the front panel P.C. Board the text "Excel-Arc" and "Arc-Master" should be printed. Using a needle nose pliers, remove the black jumper. Connect the jumper to the "Excel-Arc" pins as shown below. Reassemble the case.

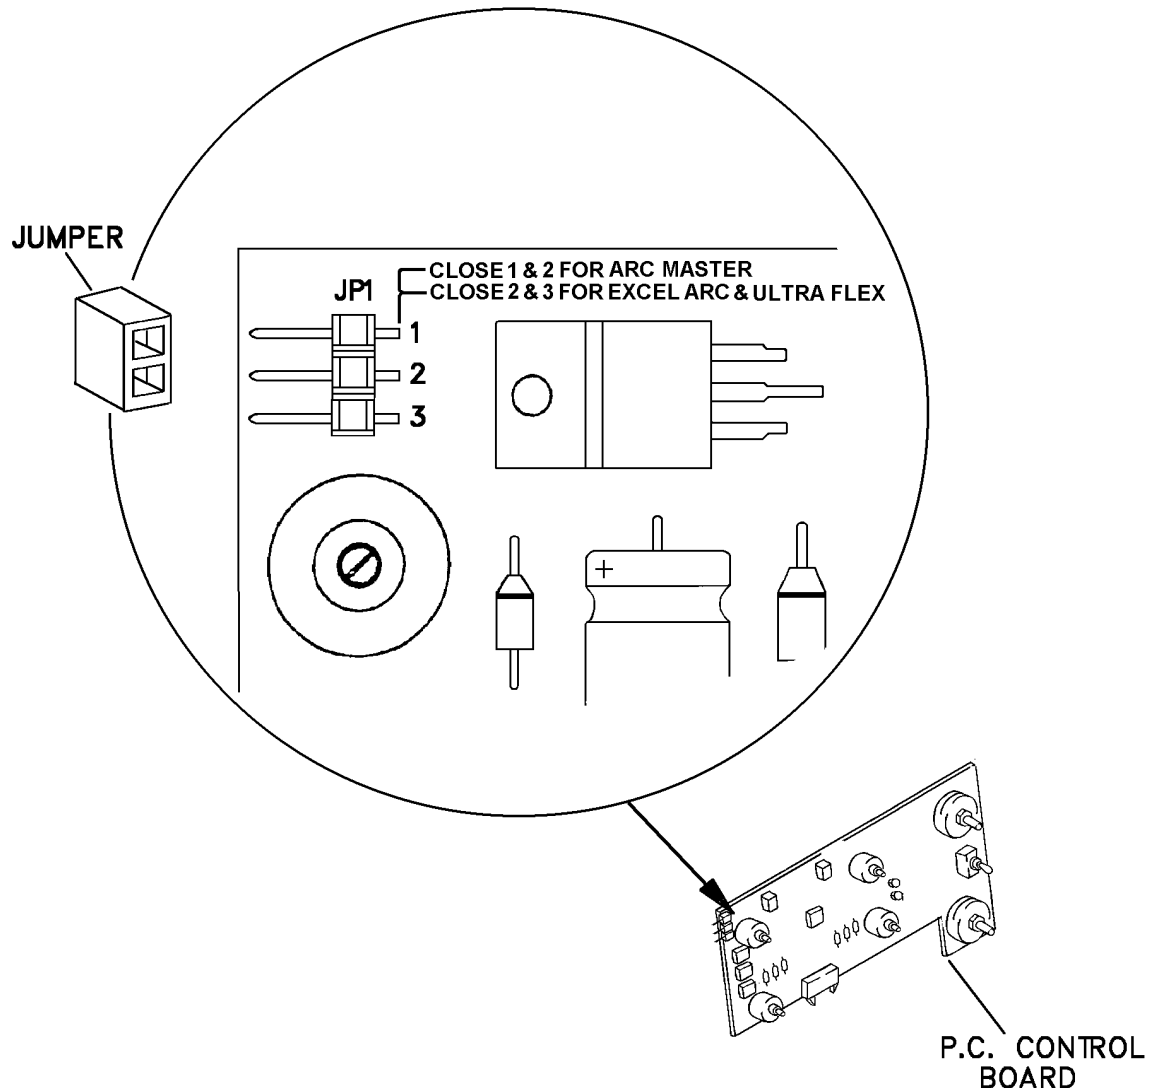


Install the jumper on pins 1 and 2 for Arc-Master.

Install the jumper on pins 2 and 3 for Excel-Arc and Ultra Flex.

Figure 5

TYPICAL INSTALLATION

LIFT ARC TIG

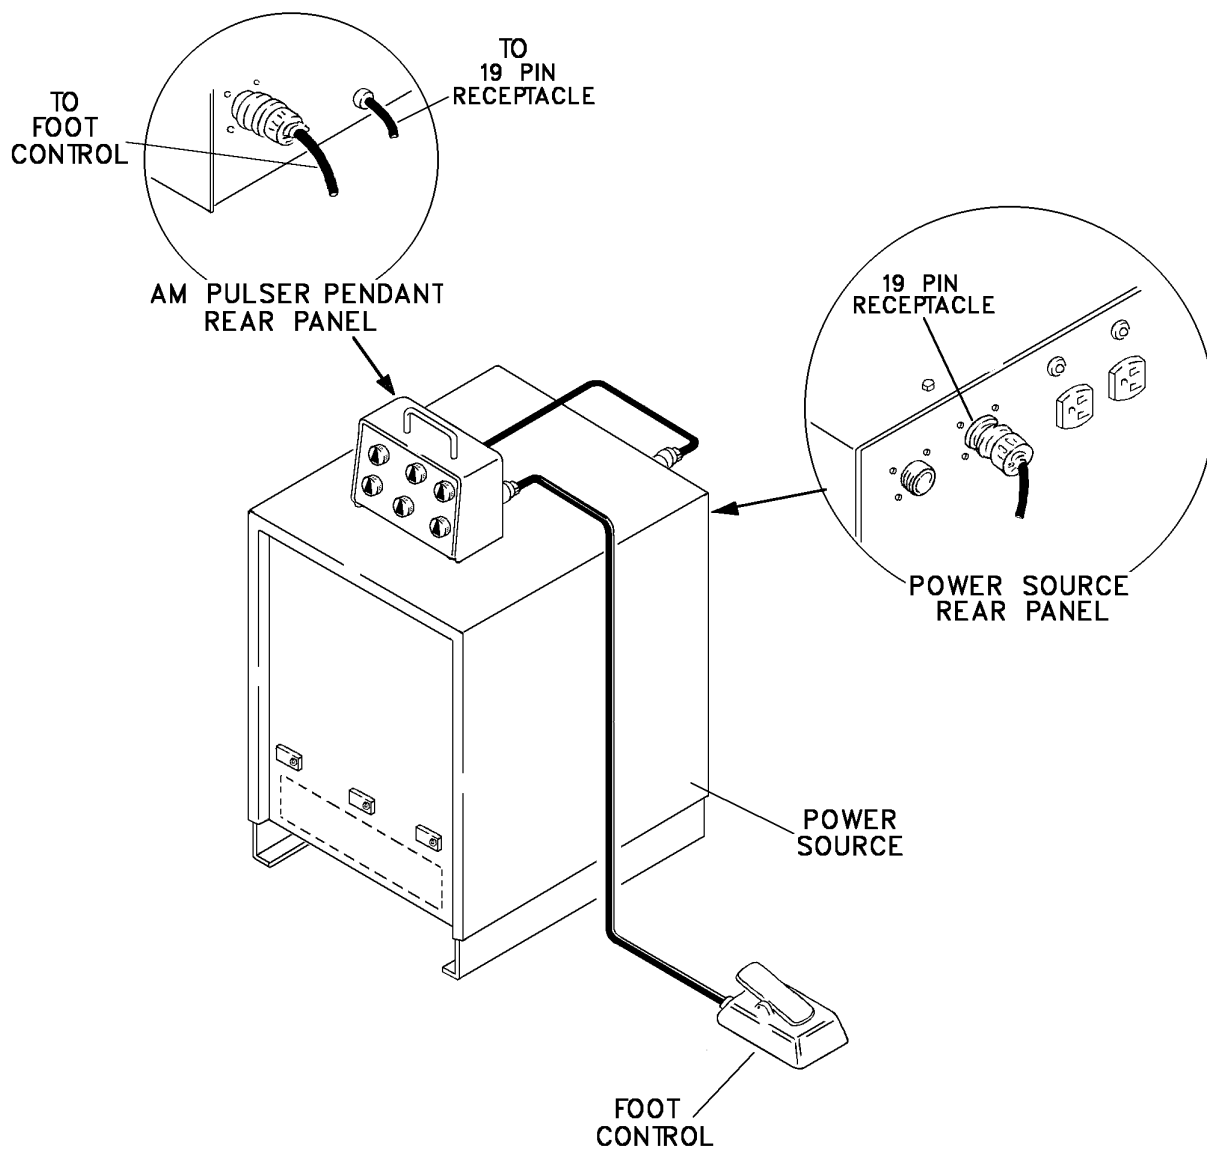


NOTE: The EXCEL-ARC Tig/Stick switch should be in the Touch Start position.

The ARC-MASTER Output Control switch must be in the Remote position and Process Selector switch in TIG.

Figure 6

TYPICAL INSTALLATION

IMPULSE START TIG

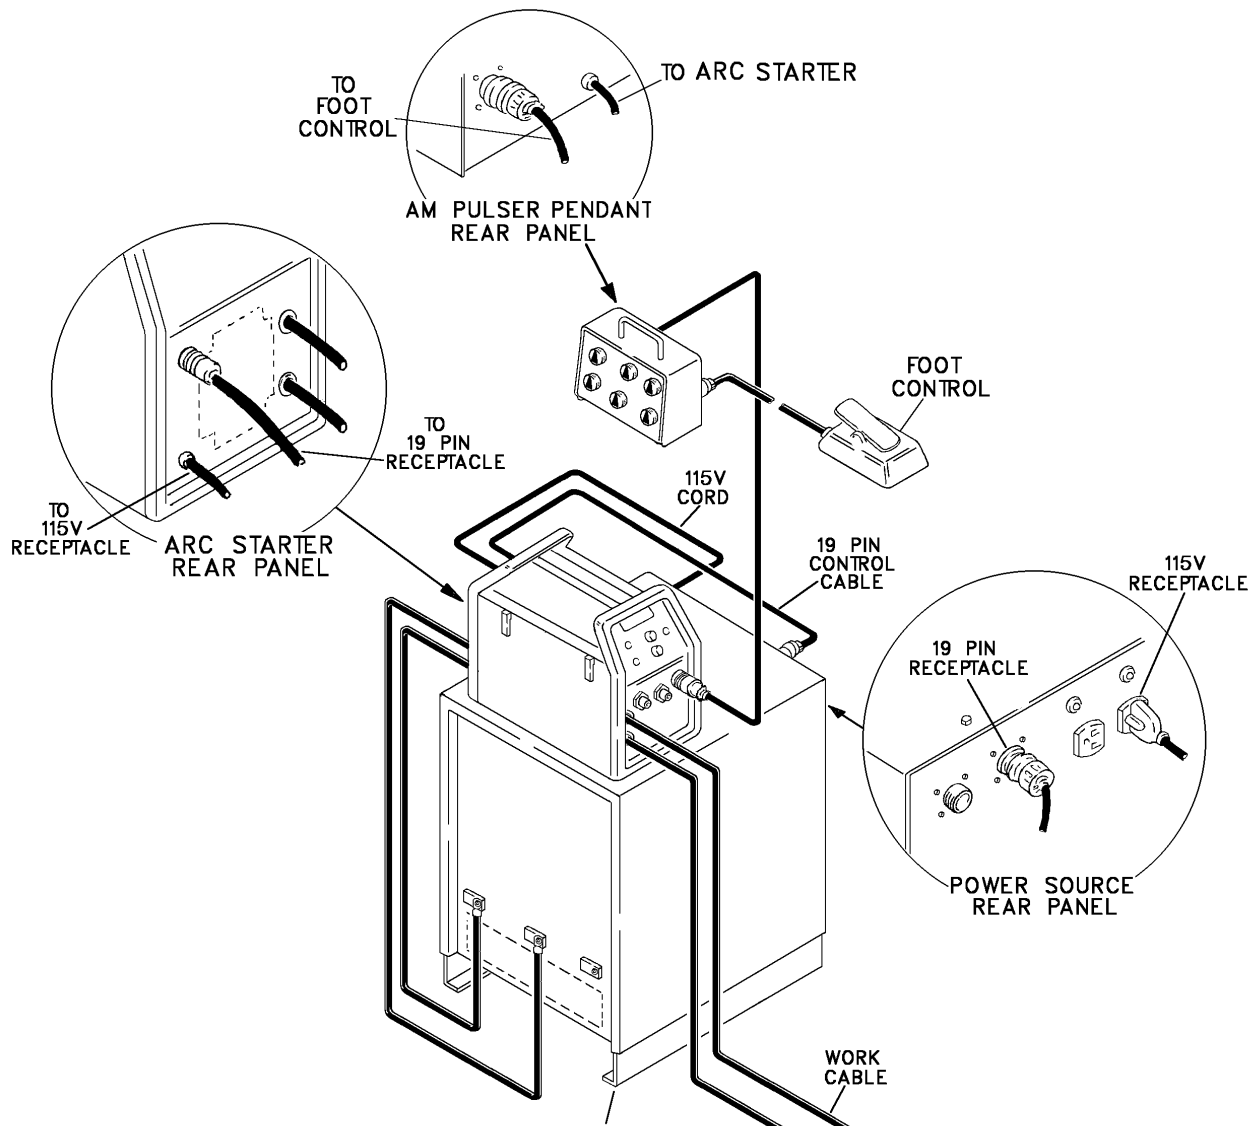

NOTE: The EXCEL-ARC Tig/Stick switch must be in the Stick/Impulse Start position.

The ARC-MASTER Output Control switch must be in the Remote position and the Process Selector switch in GTAW.

The Ultra Flex 350 CC/CV must be set to the GTAW mode and REMOTE button activated.

The Ultra Flex 350 Pulse must be set to the LIFT GTAW mode, with the LIFT START disabled

Figure 7

Parts List

See Parts List, Figure 8, for part numbers of Remote Pulse Pendant.

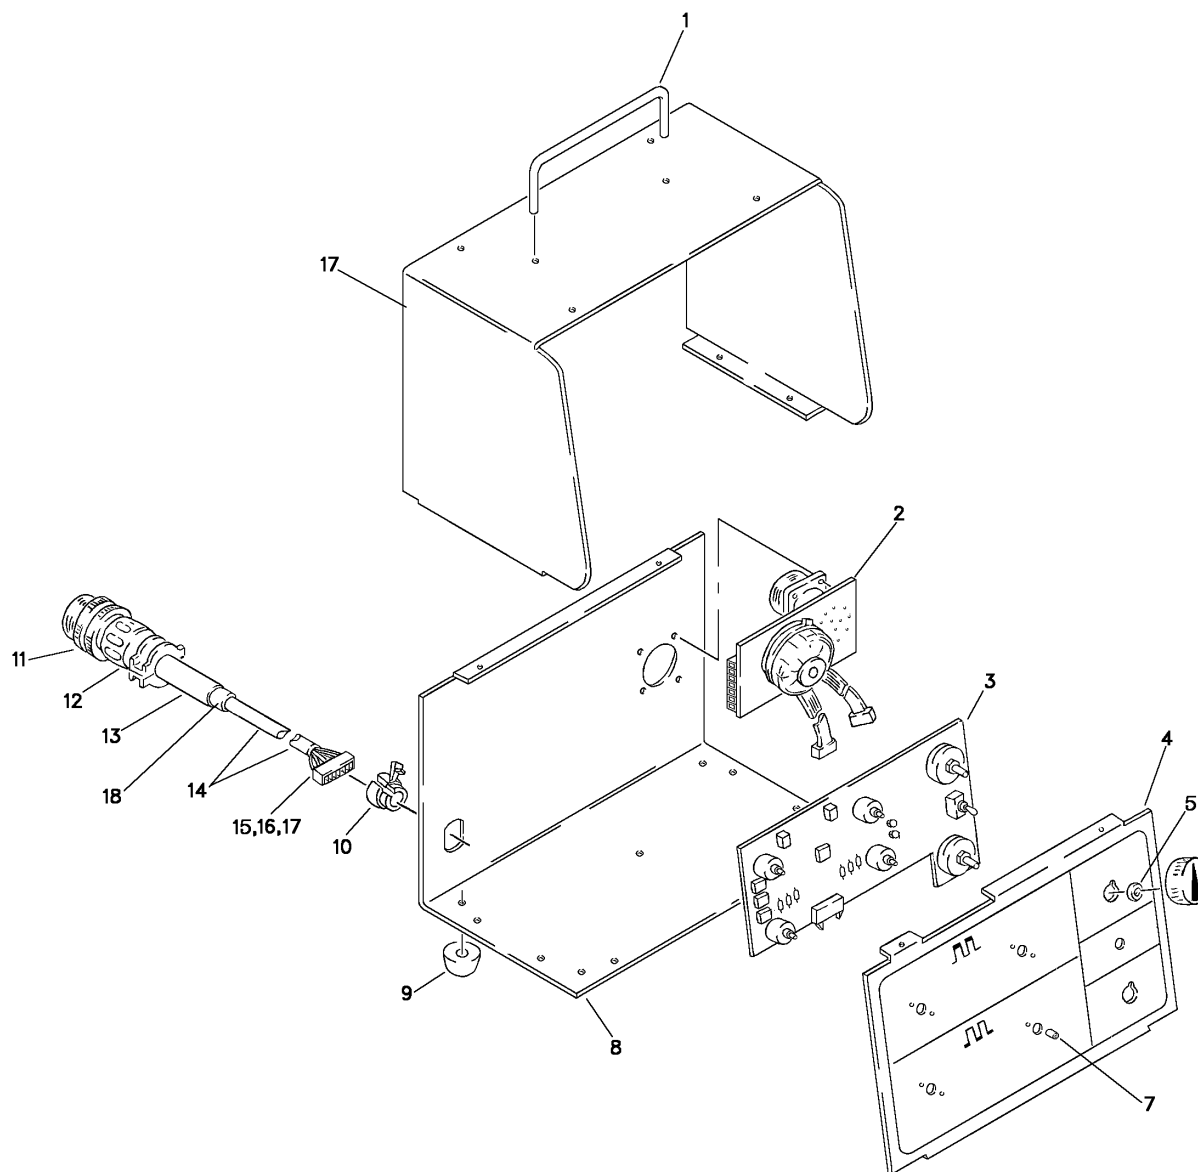


Figure 8

Parts List for Figure 8

Item No	Part Number	Description	Qty per Assy	Application Code
	204297-1	Pendant - Pulsation/Remote	1	A
	204297A-1	Pendant - Pulsation/Remote	1	B
1	483102	. Handle	1	All
2	204292	. Board - P.C. Choke Assembly	1	All
3	204294	. Board - P.C. Control Assembly	1	All
4	204298	. Panel - Front	1	A
	204298-1	. Panel - Front	1	B
5	409870	. Washer - Insulator	2	All
6	406806-1	. Knob - Control	6	A
	406806-2	. Knob - Control	6	B
7	404454	. Reducer - Hole, Shaft	4	All
8	204299	. Panel - Base	1	A
	204299-1	. Panel - Base	1	B
9	403153-1	. Foot - Rubber	4	All
10	TRY-119-5	. Strain - Relief	1	All
11	400214	. Plug - Straight, 19 Pin Male	1	All
12	16DA-5082	. Clamp - Cable	1	All
13	404117-4	. Bushing - Rubber	1	All
14	85652	. Cable - #22-15	6.5 Ft.	All
15	408093-1	. Terminal - Quick Connect	10	All
16	408092-5	. Receptacle - Clamp Locking	1	All
17	204126	. Panel - Top	1	A
	204126-1	. Panel - Top	1	B
—	400792-12	. Terminal - Ring Tongue, Insulated	1	All
18	404117-3	. Bushing - Rubber	1	All

—

Not Illustrated

This page intentionally left blank.